



Customer:	Hilong Oil Services & Engineering	Date Of Service:	07/12/2023
Type Of Inspection:	CAT III INSPECTION	Report No:	ATS-12-23-2486-MKB-001
Rig & Rig Number:	HL 99	Specification:	API RP 4G



**ABERDEEN Technical Services Would Like to Thank You for Giving Us the Opportunity to Work With Your Honorable Company**

Inspection Date:	07/12/2023	Due Date:	06/12/2025
Inspector:	JAAFAR BADR	Supervisor:	Hassan Omran
OEM:			



Tel: +964 7822334444 | +964 782222633

Emails: [akader@aberdeents.com](mailto:akader@aberdeents.com)

[inspection@aberdeents-ig.com](mailto:inspection@aberdeents-ig.com)



Customer:	Hilong Oil Services & Engineering	Date Of Service:	07/12/2023
Type Of Inspection:	CAT III INSPECTION	Report No:	ATS-12-23-2486-MKB-001
Rig & Rig Number:	HL 99	Specification:	API RP 4G

The Rig Was Equipped with SJ PETROUM MACHINERY CO. Monk Board, with The Following Specification:

Equipment:	Monkey Board (Racking Platform)
Model:	Z04160000359AA
S/N:	180701
Marker Manufacture:	SJ PETROUM MACHINERY CO.
Ref Standard:	API RP 4G
Date Of Manufacture:	07-2018

QTY:	1 (set)
Frequency of Examination:	Every 2 Years

**Remarks:**  
Detailed reports are attached detailing all readings and results in pages (08-19).

Inspector:	Jaafar Badr	Supervisor:	Hasan Omran
------------	-------------	-------------	-------------





Customer:	Hilong Oil Services & Engineering	Date Of Service:	07/12/2023
Type Of Inspection:	CAT III INSPECTION	Report No:	ATS-12-23-2486-MKB-001
Rig & Rig Number:	HL 99	Specification:	API RP 4G

**PROCEDURE**


- The Monkey Board Has Been Inspected and Found Conformable to the Relevant Standard.
- The Rig was equipped with SJ PETROUM MACHINERY CO. Monkey Board.

Action	Result
1. Monkey board was found partly stripped down /assembled for CAT III Inspection.	Performed
2. Thoroughly visual inspection of the main frame for bends, cracks, and deformations.	Performed
3. Manufacture Name Plate in Place, All Specification of the monkey board Were Obtained from Attached Manufacture Manual and Manufacture Certificate.	Performed
4. Thoroughly visual examine and MPI all of the Monkey board connections and supporting pad eyes	Performed
5. Thorough visual examination & MPI was carried out on the connections and critical areas of monkey board fingers.	Performed
6. Thorough visual examination & MPI was carried out on the monkey board walkway	Performed
7. All the monkey board connections and pad eyes were sequentially marked with hard stencil punches.	Performed
8. Thorough visual examination & MPI was carried out on the monkey board hinges.	Performed
9. Thorough visual examination & MPI was carried out on the monkey board posts.	Performed
10. Prepare and submit the inspection report.	Performed

\*\* Visual and MPI Was Carried Out on the Available Critical& Welding Areas of the Monkey Board and Found **Satisfactory for Further Use.**

\*\* CAT III Inspection Was Carried Out on Monkey Board and Found **Accepted** at The Time of Inspection.

Inspector:	Jaafar Badr	Supervisor:	Hasan Omran
OEM:			

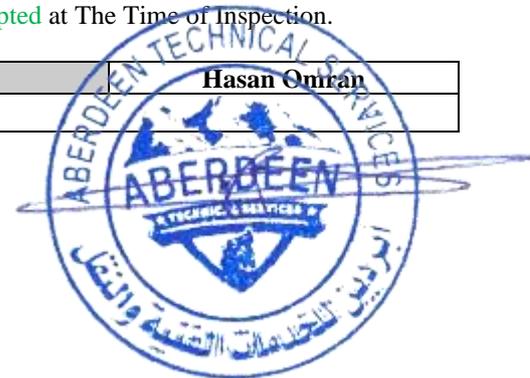



Customer:	Hilong Oil Services & Engineering	Date Of Service:	07/12/2023
Type Of Inspection:	CAT III INSPECTION	Report No:	ATS-12-23-2486-MKB-001
Rig & Rig Number:	HL 99	Specification:	API RP 4G

**PICTORIAL:**



PIC#01



PIC#02



PIC#03



PIC#04





Customer:	Hilong Oil Services & Engineering	Date Of Service:	07/12/2023
Type Of Inspection:	CAT III INSPECTION	Report No:	ATS-12-23-2486-MKB-001
Rig & Rig Number:	HL 99	Specification:	API RP 4G

**PICTORIAL:**



PIC#05



PIC#06



PIC#07



PIC#08





Customer:	Hilong Oil Services & Engineering	Date Of Service:	07/12/2023
Type Of Inspection:	CAT III INSPECTION	Report No:	ATS-12-23-2486-MKB-001
Rig & Rig Number:	HL 99	Specification:	API RP 4G

**PICTORIAL:**



PIC#09



PIC#10



PIC#11



PIC#12



Customer:	Hilong Oil Services & Engineering	Date Of Service:	07/12/2023
Type Of Inspection:	CAT III INSPECTION	Report No:	ATS-12-23-2486-MKB-001
Rig & Rig Number:	HL 99	Specification:	API RP 4G

**INSPECTION CHECKLIST RESULTS:**

Substructure			
01- Monkey Board			
Condition	Accepted	Rejected	Remarks
Frame Straight		√	Check at regular frequencies
Pin Hole		√	Check at regular frequencies
Pins		√	Check at regular frequencies
Safety Pin /Keepers		√	Check at regular frequencies
Frame Weld		√	Check at regular frequencies
Working Platform		√	Check at regular frequencies
Landing Platform		√	Check at regular frequencies
Hand Rails		√	Check at regular frequencies
Ladder Access		√	Check at regular frequencies
Finger Straight		√	Check at regular frequencies
Finger Welds		√	Check at regular frequencies
Finger safety Line		√	Check at regular frequencies
Hoist Mounting		√	Check at regular frequencies

**Remarks:**  
**CAT III inspection was performed on the Monkey Board and found accepted at the time of inspection**

Inspector:	Jaafar Badr	Supervisor:	Hasan Omran
OEM:			





Customer:	Hilong Oil Services & Engineering	Date Of Service:	07/12/2023
Type Of Inspection:	CAT III INSPECTION	Report No:	ATS-12-23-2486-MKB-001
Rig & Rig Number:	HL 99	Specification:	API RP 4G

**Certificate of Thorough Examination & NDT of Lifting Equipment**

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

Client Name:	Hilong Oil Services & Engineering	Rig Number:	HL99	Job Number:	ATS-12-23-2486-MKB-001
--------------	-----------------------------------	-------------	------	-------------	------------------------

Date of Examination:	07/12/2023	Date of Report:	07/12/2023	Certificate No:	ATS-12-23-2486-MKB-001-01
----------------------	------------	-----------------	------------	-----------------	---------------------------

Serial Number:	QTY	Description	SWL	Date of last Thorough examination
JJ020 JJ021	02	<b>Fabricated Pad Eyes</b>  Pad Eye Dimension Thickness: 20 MM Pin Hole : 50 MM Length : 132 MM Height : 147 MM  Location : Monkey Board	3 TON	N/A
		 		

<b>Reference Standard:</b>	LEEA DOC 048:2015			
Is this the first examination after Installation or assembly at a new site or location?	YES	<input type="checkbox"/>	NO	<input checked="" type="checkbox"/>
	Was the examination carried out: Within an interval of 6 months? With an interval of 12 months?			
If the answer to the above question is YES has the equipment been installed correctly?	YES	<input type="checkbox"/>	NO	<input type="checkbox"/>
	In accordance with an examination scheme? After the occurrence of exceptional circumstances?			
Identification of any part found to have a defect which is or could not become a danger to persons and a description of the defect: (If none Sate NONE) <b>None</b>				
Is the above a defect which is of immediate danger to persons:				YES <input type="checkbox"/> NO <input type="checkbox"/>
Is the above a defect which is not yet but could become a danger to persons (If YES state the date by when)				N/A
Particulars of any repair, renewal or alteration required to remedy the defect identified above: <b>None</b>				
<b>IS THIS EQUIPMENT SAFE TO OPERATE?</b>				
				YES <input checked="" type="checkbox"/> NO <input type="checkbox"/>

NDT Equipment Details					
Standard	API RP 4G CAT III & ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-10	Due Date	17-02-2024
White Contrast	FLUXO: WCP-4	Batch No:	L230523/1	Due Date	23-05-2028
Black Ink	FLUXO: Black magnetic ink-3	Batch No:	L230125/3	Due Date	25-1-2025

NDT Results	
Visual and MPI carried out for the above description and found free of surface defects at the time of inspection	
Identification of any part found to have a defect and a description of the defect: <b>None</b>	
Particulars of any repair, renewal or alteration required to remedy the defect identified above: <b>None</b>	

Name of Inspector:	Name of person authenticating this report:
Jaafar Badr	Hasan Omran
	Signature & Stamp:
Latest date by which next thorough examination must be carried out: 06-06-2024	





Customer:	Hilong Oil Services & Engineering	Date Of Service:	07/12/2023
Type Of Inspection:	CAT III INSPECTION	Report No:	ATS-12-23-2486-MKB-001
Rig & Rig Number:	HL 99	Specification:	API RP 4G

**Certificate of Thorough Examination & NDT of Lifting Equipment**

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

Client Name:	Hilong Oil Services & Engineering	Rig Number:	HL99	Job Number:	ATS-12-23-2486-MKB-001
--------------	-----------------------------------	-------------	------	-------------	------------------------

Date of Examination:	07/12/2023	Date of Report:	07/12/2023	Certificate No:	ATS-12-23-2486-MKB-001-02
----------------------	------------	-----------------	------------	-----------------	---------------------------

Serial Number:	QTY	Description	SWL	Date of last Thorough examination
JJ01 JJ02	02	<b>Fabricated Pad Eyes</b>  Pad Eye Dimension Thickness: 20 MM Pin Hole : 50 MM Length : 104 MM Height : 110 MM  Location : Monkey Board	2 TON	N/A
				

Reference Standard: LEEA DOC 048:2015

Is this the first examination after Installation or assembly at a new site or location?	YES	NO	√	Was the examination carried out: Within an interval of 6 months? With an interval of 12 months? In accordance with an examination scheme? After the occurrence of exceptional circumstances?	YES	√	NO	
					YES		NO	√
If the answer to the above question is YES has the equipment been installed correctly?	YES	NO			YES	√	NO	
					YES		NO	√

Identification of any part found to have a defect which is or could not become a danger to persons and a description of the defect: (If none State NONE) **None**

Is the above a defect which is of immediate danger to persons: **None** YES NO

Is the above a defect which is not yet but could become a danger to persons (If YES state the date by when) N/A

Particulars of any repair, renewal or alteration required to remedy the defect identified above: **None**

**IS THIS EQUIPMENT SAFE TO OPERATE?** YES √ NO

NDT Equipment Details					
Standard	Viewing Condition:	Colored Media	Method	WET	
API RP 4G CAT III & ASTM E709					
Yoke	Permanent	Serial No:	PY-10	Due Date	17-02-2024
White Contrast	FLUXO: WCP-4	Batch No:	L230523/1	Due Date	23-05-2028
Black Ink	FLUXO: Black magnetic ink-3	Batch No:	L230125/3	Due Date	25-1-2025

**NDT Results**

Visual and MPI carried out for the above description and found free of surface defects at the time of inspection

Identification of any part found to have a defect and a description of the defect: **None**

Particulars of any repair, renewal or alteration required to remedy the defect identified above: **None**

Name of Inspector:	Name of person authenticating this report:
Jafaar Badr	Hasan Omran
	Signature & Stamp:
Latest date by which next thorough examination must be carried out: 06-06-2024	





Customer:	Hilong Oil Services & Engineering	Date Of Service:	07/12/2023
Type Of Inspection:	CAT III INSPECTION	Report No:	ATS-12-23-2486-MKB-001
Rig & Rig Number:	HL 99	Specification:	API RP 4G

## Visual & Magnetic Particles Examination Report

Client Name:	Hilong Oil Services & Engineering	Rig Number:	HL99	Job Number:	ATS-12-23-2486-MKB-001
--------------	-----------------------------------	-------------	------	-------------	------------------------

Date of Examination:	07/12/2023	Date of Report:	07/12/2023	Certificate No:	ATS-12-23-2486-MKB-001-03
----------------------	------------	-----------------	------------	-----------------	---------------------------

Serial Number	Description of the examined equipment	Result
180701	Monkey Board Connection Pad Eyes	Pass
Connection Pad S/N:	F1, F2, F3, F4, F5, F6, F7 ,F8 ,F9 ,F10	



### NDT Equipment Details

Standard	API RP 4G CAT-III & ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	16-02-2024
White Contrast	FLUXO: WCP-4	Batch No:	L230523/1	Due Date	23-05-2028
Black Ink	FLUXO: Black magnetic ink-3	Batch No:	L230125/3	Due Date	25-1-2025

### NDT Results

Visual and MPI carried out for the above-mentioned items and found free of surface defects at the time of inspection

Identification of any part found to have a defect and a description of the defect: **None**

Particulars of any repair, renewal or alteration required to remedy the defect identified above: **None**

ASNT Level II Inspector Name:	Signature & Stamp:	Date of Next Through Examination:
Jafaar Badr		06/06/2024




Customer:	Hilong Oil Services & Engineering	Date Of Service:	07/12/2023
Type Of Inspection:	CAT III INSPECTION	Report No:	ATS-12-23-2486-MKB-001
Rig & Rig Number:	HL 99	Specification:	API RP 4G

## Visual & Magnetic Particles Examination Report

Client Name:	Hilong Oil Services & Engineering	Rig Number:	HL99	Job Number:	ATS-12-23-2486-MKB-001
--------------	-----------------------------------	-------------	------	-------------	------------------------

Date of Examination:	07/12/2023	Date of Report:	07/12/2023	Certificate No:	ATS-12-23-2486-MKB-001-04
----------------------	------------	-----------------	------------	-----------------	---------------------------

Serial Number	Description of the examined equipment	Result
180701	Monkey Board Pad Eyes	Pass
Connection Pad S/N:	J1,J2,J3,J4,J5,J6	

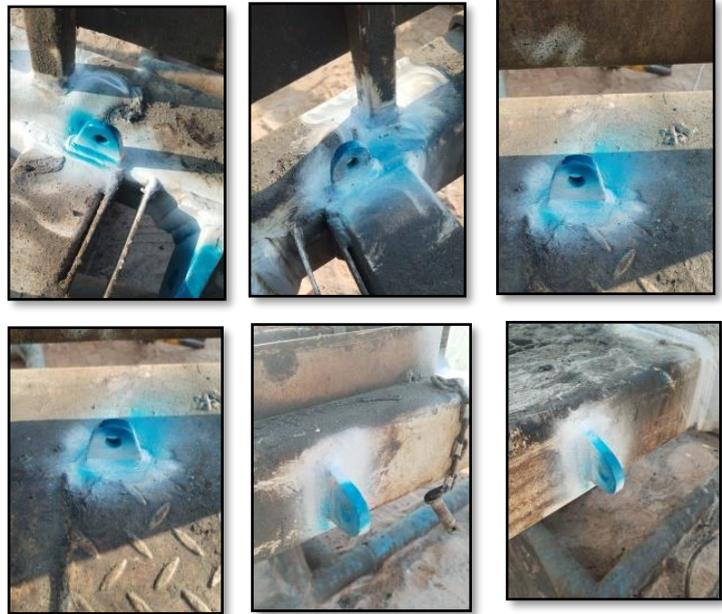

### NDT Equipment Details

Standard	API RP 4G CAT-III & ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	16-02-2024
White Contrast	FLUXO: WCP-4	Batch No:	L230523/1	Due Date	23-05-2028
Black Ink	FLUXO: Black magnetic ink-3	Batch No:	L230125/3	Due Date	25-1-2025

### NDT Results

Visual and MPI carried out for the above-mentioned items and found free of surface defects at the time of inspection

Identification of any part found to have a defect and a description of the defect: **None**

Particulars of any repair, renewal or alteration required to remedy the defect identified above: **None**

ASNT Level II Inspector Name:	Signature & Stamp:	Date of Next Through Examination:
Jaafar Badr		06/06/2024





Customer:	Hilong Oil Services & Engineering	Date Of Service:	07/12/2023
Type Of Inspection:	CAT III INSPECTION	Report No:	ATS-12-23-2486-MKB-001
Rig & Rig Number:	HL 99	Specification:	API RP 4G

## Visual & Magnetic Particles Examination Report

Client Name:	Hilong Oil Services & Engineering	Rig Number:	HL99	Job Number:	ATS-12-23-2486-MKB-001
--------------	-----------------------------------	-------------	------	-------------	------------------------

Date of Examination:	07/12/2023	Date of Report:	07/12/2023	Certificate No:	ATS-12-23-2486-MKB-001-05
----------------------	------------	-----------------	------------	-----------------	---------------------------

Serial Number	Description of the examined equipment	Result
180701	Monkey Board Snatch Block Connection Pad Eyes	Pass
Connection Pad S/N:	JF01,JF02	



### NDT Equipment Details

Standard	API RP 4G CAT-III & ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	16-02-2024
White Contrast	FLUXO: WCP-4	Batch No:	L230523/1	Due Date	23-05-2028
Black Ink	FLUXO: Black magnetic ink-3	Batch No:	L230125/3	Due Date	25-1-2025

### NDT Results

Visual and MPI carried out for the above-mentioned items and found free of surface defects at the time of inspection

Identification of any part found to have a defect and a description of the defect: **None**

Particulars of any repair, renewal or alteration required to remedy the defect identified above: **None**

ASNT Level II Inspector Name:	Signature & Stamp:	Date of Next Through Examination:
Jaafar Badr		06/06/2024



Customer:	Hilong Oil Services & Engineering	Date Of Service:	07/12/2023
Type Of Inspection:	CAT III INSPECTION	Report No:	ATS-12-23-2486-MKB-001
Rig & Rig Number:	HL 99	Specification:	API RP 4G

## Visual & Magnetic Particles Examination Report

Client Name:	Hilong Oil Services & Engineering	Rig Number:	HL99	Job Number:	ATS-12-23-2486-MKB-001
--------------	-----------------------------------	-------------	------	-------------	------------------------

Date of Examination:	07/12/2023	Date of Report:	07/12/2023	Certificate No:	ATS-12-23-2486-MKB-001-06
----------------------	------------	-----------------	------------	-----------------	---------------------------

Serial Number	Description of the examined equipment	Result
180701	Monkey Board Fingers	Pass



### NDT Equipment Details

Standard	API RP 4G CAT-III & ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	16-02-2024
White Contrast	FLUXO: WCP-4	Batch No:	L230523/1	Due Date	23-05-2028
Black Ink	FLUXO: Black magnetic ink-3	Batch No:	L230125/3	Due Date	25-1-2025

### NDT Results

Visual and MPI carried out for the above-mentioned items and found free of surface defects at the time of inspection
Identification of any part found to have a defect and a description of the defect: <b>None</b>
Particulars of any repair, renewal or alteration required to remedy the defect identified above: <b>None</b>

ASNT Level II Inspector Name:	Signature & Stamp:	Date of Next Through Examination:
Jaafar Badr		06/06/2024



Customer:	Hilong Oil Services & Engineering	Date Of Service:	07/12/2023
Type Of Inspection:	CAT III INSPECTION	Report No:	ATS-12-23-2486-MKB-001
Rig & Rig Number:	HL 99	Specification:	API RP 4G

## Visual & Magnetic Particles Examination Report

Client Name:	Hilong Oil Services & Engineering	Rig Number:	RIG-99	Job Number:	ATS-12-23-2486
--------------	-----------------------------------	-------------	--------	-------------	----------------

Date of Examination:	07-12-2023	Date of Report:	07-12-2023	Certificate No:	ATS-12-23-2486-MKB-001-07
----------------------	------------	-----------------	------------	-----------------	---------------------------

Serial Number	Description of the examined equipment	Result
180701	Monkey Board Welding Area	Pass



### NDT Equipment Details

Standard	API RP 4G CAT-III & ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	16-02-2024
White Contrast	FLUXO: WCP-4	Batch No:	L230523/1	Due Date	23-05-2028
Black Ink	FLUXO: Black magnetic ink-3	Batch No:	L230125/3	Due Date	25-1-2025


### NDT Results

Visual and MPI carried out for the above-mentioned items and found free of surface defects at the time of inspection

Identification of any part found to have a defect and a description of the defect: **None**

Particulars of any repair, renewal or alteration required to remedy the defect identified above: **None**

ASNT Level II Inspector Name:	Signature & Stamp:	Date of Next Through Examination:
JAAFAR BADR		06/06/2024

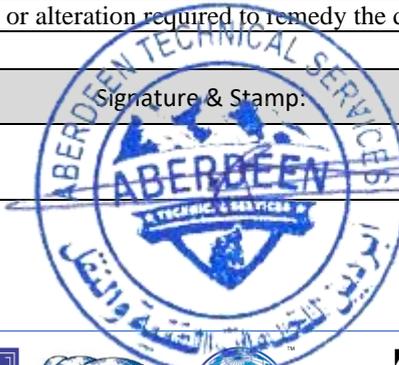




Customer:	Hilong Oil Services & Engineering	Date Of Service:	07/12/2023
Type Of Inspection:	CAT III INSPECTION	Report No:	ATS-12-23-2486-MKB-001
Rig & Rig Number:	HL 99	Specification:	API RP 4G

## Visual & Magnetic Particles Examination Report

Client Name:	Hilong Oil Services & Engineering	Rig Number:	RIG-99	Job Number:	ATS-12-23-2486
--------------	-----------------------------------	-------------	--------	-------------	----------------

Date of Examination:	07-12-2023	Date of Report:	07-12-2023	Certificate No:	ATS-12-23-2486-MKB-001-08
----------------------	------------	-----------------	------------	-----------------	---------------------------

Serial Number	Description of the examined equipment	Result
180701	Monkey Board Fall arrester & Escape Device Pad Eye	Pass
Pad Eye S/N:	JJ019, JJ018, JJ017, JJ016	

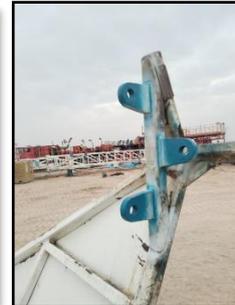

### NDT Equipment Details

Standard	API RP 4G CAT-III & ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	16-02-2024
White Contrast	FLUXO: WCP-4	Batch No:	L230523/1	Due Date	23-05-2028
Black Ink	FLUXO: Black magnetic ink-3	Batch No:	L230125/3	Due Date	25-1-2025

### NDT Results

Visual and MPI carried out for the above-mentioned items and found free of surface defects at the time of inspection

Identification of any part found to have a defect and a description of the defect: **None**

Particulars of any repair, renewal or alteration required to remedy the defect identified above: **None**

ASNT Level II Inspector Name:	Signature & Stamp:	Date of Next Through Examination:
Jafaar Badr		06/06/2024



Customer:	Hilong Oil Services & Engineering	Date Of Service:	07/12/2023
Type Of Inspection:	CAT III INSPECTION	Report No:	ATS-12-23-2486-MKB-001
Rig & Rig Number:	HL 99	Specification:	API RP 4G

**Certificate of Thorough Examination & NDT of Lifting Equipment**

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

Client Name:	Hilong Oil Services & Engineering	Rig Number:	RIG-99	Job Number:	ATS-12-23-2486
Date of Examination:	07-12-2023	Date of Report:	07-12-2023	Certificate No:	ATS-12-23-2486-MKB-001-09

Serial Number:	QTY	Description	SWL	Date of last Thorough examination
JJ019 JJ018 JJ017 JJ016	04	<b>Fabricated Pad Eyes</b>  Pad Eye Dimension Thickness: 20 MM Pin Hole : 25 MM Length : 82MM Height : 110 MM  Location : Monkey Board	2.5 TON	N/A

<b>Reference Standard:</b>	LEEA DOC 048:2015		
Is this the first examination after Installation or assembly at a new site or location?	YES <input type="checkbox"/>	NO <input checked="" type="checkbox"/>	Was the examination carried out: Within an interval of 6 months? YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> With an interval of 12 months? YES <input type="checkbox"/> NO <input checked="" type="checkbox"/>
If the answer to the above question is YES has the equipment been installed correctly?	YES <input type="checkbox"/>	NO <input type="checkbox"/>	In accordance with an examination scheme? YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> After the occurrence of exceptional circumstances? YES <input type="checkbox"/> NO <input checked="" type="checkbox"/>
Identification of any part found to have a defect which is or could not become a danger to persons and a description of the defect: (If none State NONE) <b>NONE</b>			
Is the above a defect which is of immediate danger to persons:			YES <input type="checkbox"/> NO <input type="checkbox"/>
Is the above a defect which is not yet but could become a danger to persons (If YES state the date by when)			N/A
Particulars of any repair, renewal or alteration required to remedy the defect identified above: <b>NONE</b>			
<b>IS THIS EQUIPMENT SAFE TO OPERATE?</b>			
			YES <input checked="" type="checkbox"/> NO <input type="checkbox"/>

NDT Equipment Details					
Standard	API RP 4G CAT III & ASTM E709	Viewin Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-10	Due Date	17-02-2024
White Contrast	FLUXO: WCP-4	Batch No:	L230523/1	Due Date	23-05-2028
Black Ink	FLUXO: Black magnetic ink-3	Batch No:	L230125/3	Due Date	25-1-2025

<b>NDT Results</b>	
Visual and MPI carried out for the above description and found free of surface defects at the time of inspection	
Identification of any part found to have a defect and a description of the defect: <b>NONE</b>	
Particulars of any repair, renewal or alteration required to remedy the defect identified above: <b>NONE</b>	

Name of Inspector:	Name of person authenticating this report:	
Jaafar Badr	Hasan Omran	
<b>Signature &amp; Stamp:</b>		
Latest date by which next thorough examination must be carried out: <b>06-06-2024</b>		



Customer:	Hilong Oil Services & Engineering	Date Of Service:	07/12/2023
Type Of Inspection:	CAT III INSPECTION	Report No:	ATS-12-23-2486-MKB-001
Rig & Rig Number:	HL 99	Specification:	API RP 4G

## Visual & Magnetic Particles Examination Report

Client Name:	Hilong Oil Services & Engineering	Rig Number:	RIG-99	Job Number:	ATS-12-23-2486
--------------	-----------------------------------	-------------	--------	-------------	----------------

Date of Examination:	07-12-2023	Date of Report:	07-12-2023	Certificate No:	ATS-12-23-2486-MKB-001-10
----------------------	------------	-----------------	------------	-----------------	---------------------------

Serial Number	Description of the examined equipment	Result
180701	Monkey Board Connection Points	Pass
Connection Pad S/N:	D11,D12,D13,D14,D15,D16,D17	



### NDT Equipment Details

Standard	API RP 4G CAT-III & ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	16-02-2024
White Contrast	FLUXO: WCP-4	Batch No:	L230523/1	Due Date	23-05-2028
Black Ink	FLUXO: Black magnetic ink-3	Batch No:	L230125/3	Due Date	25-1-2025

### NDT Results

Visual and MPI carried out for the above-mentioned items and found free of surface defects at the time of inspection

Identification of any part found to have a defect and a description of the defect: **None**

Particulars of any repair, renewal or alteration required to remedy the defect identified above: **None**

ASNT Level II Inspector Name:	Signature & Stamp:	Date of Next Through Examination:
Jaafar Badr		06/06/2024



Customer:	Hilong Oil Services & Engineering	Date Of Service:	07/12/2023
Type Of Inspection:	CAT III INSPECTION	Report No:	ATS-12-23-2486-MKB-001
Rig & Rig Number:	HL 99	Specification:	API RP 4G

## Visual & Magnetic Particles Examination Report

Client Name:	Hilong Oil Services & Engineering	Rig Number:	RIG-99	Job Number:	ATS-12-23-2486
--------------	-----------------------------------	-------------	--------	-------------	----------------

Date of Examination:	07-12-2023	Date of Report:	07-12-2023	Certificate No:	ATS-12-23-2486-MKB-001-11
----------------------	------------	-----------------	------------	-----------------	---------------------------

Serial Number	Description of the examined equipment	Result
180701	Monkey Board Connection Points	Pass
Connection Pad S/N:	D18,D19,D20,D21,D22,D23,D24	



### NDT Equipment Details

Standard	API RP 4G CAT-III & ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	16-02-2024
White Contrast	FLUXO: WCP-4	Batch No:	L230523/1	Due Date	23-05-2028
Black Ink	FLUXO: Black magnetic ink-3	Batch No:	L230125/3	Due Date	25-1-2025

### NDT Results

Visual and MPI carried out for the above-mentioned items and found free of surface defects at the time of inspection
Identification of any part found to have a defect and a description of the defect: <b>None</b>
Particulars of any repair, renewal or alteration required to remedy the defect identified above: <b>None</b>

ASNT Level II Inspector Name:	Signature & Stamp:	Date of Next Through Examination:
Jaafar Badr		06/06/2024



Customer:	Hilong Oil Services & Engineering	Date Of Service:	07/12/2023
Type Of Inspection:	CAT III INSPECTION	Report No:	ATS-12-23-2486-MKB-001
Rig & Rig Number:	HL 99	Specification:	API RP 4G

## Visual & Magnetic Particles Examination Report

Client Name:	Hilong Oil Services & Engineering	Rig Number:	RIG-99	Job Number:	ATS-12-23-2486
--------------	-----------------------------------	-------------	--------	-------------	----------------

Date of Examination:	07-12-2023	Date of Report:	07-12-2023	Certificate No:	ATS-12-23-2486-MKB-001-12
----------------------	------------	-----------------	------------	-----------------	---------------------------

Serial Number	Description of the examined equipment	Result
180701	Monkey Board Connection Pad Eyes	Pass
Connection Pad S/N:	JJ015,JJ014	



### NDT Equipment Details

Standard	API RP 4G CAT-III & ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	Permanent	Serial No:	PY-09	Due Date	16-02-2024
White Contrast	FLUXO: WCP-4	Batch No:	L230523/1	Due Date	23-05-2028
Black Ink	FLUXO: Black magnetic ink-3	Batch No:	L230125/3	Due Date	25-1-2025

### NDT Results

Visual and MPI carried out for the above-mentioned items and found free of surface defects at the time of inspection

Identification of any part found to have a defect and a description of the defect: **None**

Particulars of any repair, renewal or alteration required to remedy the defect identified above: **None**

ASNT Level II Inspector Name:	Signature & Stamp:	Date of Next Through Examination:
Jaafar Badr		06/06/2024