




Aberdeen Technical Services and General Transportation

Certificate of Visual Thorough Examination and Magnetic Particle Inspection (MPI)



Client:	Hilong Oil Services & Engineering	Certificate Number:	ATS-12-23-2486-MPI-003
Rig Number:	HL99	Job No:	ATS-12-23-2486
Location:	RIG-99/HILONG BASE	Page No:	01 of 01
Date of Inspection:	11-12-2023	Next Inspection Date:	10-06-2024
Type of Inspection	Visual inspection & MPI (Wet Visible Method)	Ref. Standards:	ASTM E709, ASTM E 1444

PICTORIAL:

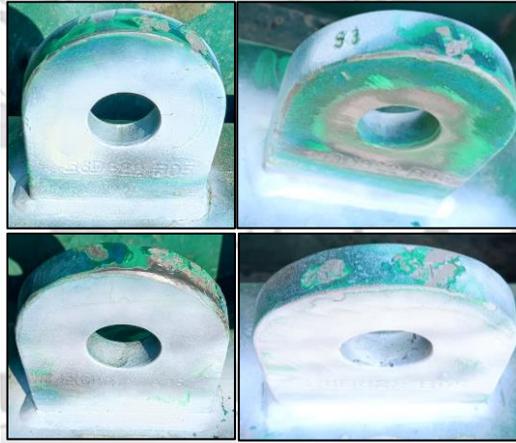

Item Description: shale shaker

Shale shaker Pad eyes					
SN:	Height (mm)	Length (mm)	PH (mm)	THK (mm)	SWL (T)
S1	120	100	36	20	3
S2	120	100	36	20	3
S3	120	100	36	20	3
S4	120	100	36	20	3

Serial Number: HL99-SH1

Details of inspection method(s):
Visible magnetic particle inspection

Inspection Results:
MPI WAS CARRIED OUT ON THE WELDING AND CRITICAL AREAS OF THE ABOVE-MENTIONED ITEM AND FOUND NO CRACKS OR RELEVANT INDICATIONS AT THE TIME OF INSPECTION.

Remarks: **ACCEPTED**

Inspection Equipment Details			Personnel Details		Company Stamp
Equipment	Ac yoke	Digital Vernier Caliper	Inspector:	Aram Dlawar	
Serial Number	201504044	8914	Qualifications	ASNT LEVEL II	
Calibration Date:	17-08-2023	17-08-2023	Date:	11-12-2023	
Calibration Due:	16-02-2024	16-02-2024	Signature:		
Consumables	MAGNETIC PARTICLES INSPECTION		Supervisor:	Hasan Omran	
Maker and Model	FLUXO	FLUXO	Date:	12-12-2023	
Type:	WCP-4	Black magnetic ink-3			
Batch Number	L230523/1	L230125/3			
Expiry Date:	23-05-2028	25-1-2025			



ATS-NDT-F-001 ISSUE 3 JUN 2023

E: akader@aberdeents.com
inspection@aberdeents-ig.com

Tel: +964 7833334444 +964 7822222633