



Customer:	Hilong Oil Services & Engineering	Date Of Service:	16-05-2024
Type Of Inspection:	CAT III INSPECTION	Report No:	ATS-05-24-3200-SC-001
Rig & Rig Number:	RIG-99	Specification:	API RP 8C



ABERDEEN Technical Services Would Like to Thank You for Giving Us the Opportunity to Work With
Your Honorable Company

Inspection Date:	16-05-2024	Due Date:	15-11-2024
------------------	------------	-----------	------------

Inspector:	Aram Dlawar	Supervisor:	Hasan Orman
Client Representative:			

International
Well Control
Forum

Tel: +964 7833334444 +964 7822222633

Emails: akader@aberdeents.com
inspection@aberdeents-iq.com



Customer:	Hilong Oil Services & Engineering	Date Of Service:	16-05-2024
Type Of Inspection:	CAT III INSPECTION	Report No:	ATS-05-24-3200-SC-001
Rig & Rig Number:	RIG-99	Specification:	API RP 8C

The Rig Was Equipped with JIANGSU RUTONG PETRO-MACHINERY CO. Safety Clamp, with The Following Specification:

Equipment:	Safety Clamp
Model/SN:	80761
Date of Manufacture:	-
Manufacturer:	JIANGSU RUTONG PETRO-MACHINERY
Reference Standard:	API RP 8C
Next Examination Date:	After 6 months

Remarks:

Detailed reports are attached detailing all readings and results in - 03 of 05 pages.

Inspector:	Aram Dlawar	Supervisor:	Hasan Omran
Client representative:			



International
Well Control
Forum



Tel: +964 7833334444 +964 7822222633

Emails: akader@aberdeents.com
inspection@aberdeents-iq.com




Customer:	Hilong Oil Services & Engineering	Date Of Service:	16-05-2024
Type Of Inspection:	CAT III INSPECTION	Report No:	ATS-05-24-3200-SC-001
Rig & Rig Number:	RIG-99	Specification:	API RP 8C

PROCEDURE	
➤ The Safety slips Has Been Inspected and Found Conformable to the Relevant Standard(s) ➤ The Rig was equipped with JIANGSU RUTONG PETRO-MACHINERY CO. LTD Safety Clamp. ➤ Safety slips Found Stripped Down /Dismantling Condition for CAT IV Inspection.	
Action	Result
• Visually check for the serial number and Identification	Pass
• Prepare and clean the clamp body and accessories to the extent necessary for inspection.	Pass
• Dismantle the clamp as far as possible into single components	Pass
• Visually Check for Cracks, Deformation, Missing Cotters Pins, Deformed Nuts, Broken Slips Springs and Movement of Slips.	Pass
• Visually Check the Threads	Pass
• Perform MPI On All Slips Elements, Pins and Hold Studs	Pass
• Reassemble the clamp	Pass
• Visually check after Reassembly	Pass
• Repaint the clamp	Pass
• Prepare and submit the inspection report.	Pass

** Visual And MPI Was Carried out on the critical areas and load bearing components of the clamp and Found **Satisfactory for Further Use**.

** CAT III Inspection Was Carried Out on the clamp and Found **Accepted**
At The Time of Inspection

Inspector:	Aram Dlawar	Supervisor:	Hasan Omran
Client representative:			

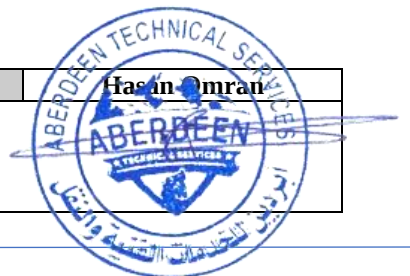
International
Well Control
Forum

Tel: +964 7833334444 +964 7822222633

Emails: akader@aberdeents.com
inspection@aberdeents-iq.com




Customer:	Hilong Oil Services & Engineering	Date Of Service:	16-05-2024
Type Of Inspection:	CAT III INSPECTION	Report No:	ATS-05-24-3200-SC-001
Rig & Rig Number:	RIG-99	Specification:	API RP 8C

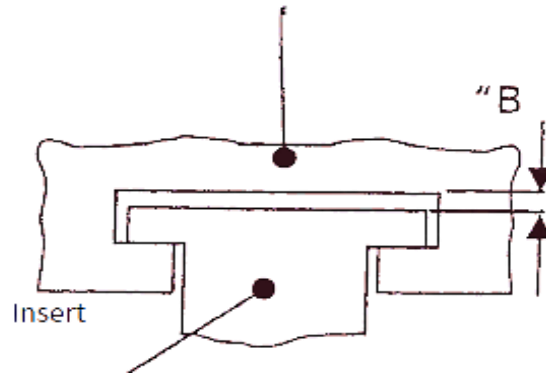

Measurement	Nominal	Tolerance	Actual Reading	Result
Insert Carrier - Insert Clearance No. 01 B	-	1.6	0.640	Accepted
Insert Carrier - Insert Clearance No. 02 B	-	1.6	0.635	Accepted
Insert Carrier - Insert Clearance No. 03 B	-	1.6	0.635	Accepted
Insert Carrier - Insert Clearance No. 04 B	-	1.6	0.635	Accepted
Insert Carrier - Insert Clearance No. 05 B	-	1.6	0.635	Accepted
Insert Carrier - Insert Clearance No. 06 B	-	1.6	0.635	Accepted
Insert Carrier - Insert Clearance No. 07 B	-	1.6	0.635	Accepted

Inspector:	Aram Dlawar	Supervisor:	Hasan Omran
Client representative:			

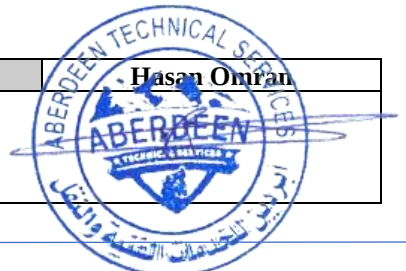International
Well Control
Forum

Tel: +964 7833334444 +964 7822222633

Emails: akader@aberdeents.cominspection@aberdeents-iq.com



Customer:	Hilong Oil Services & Engineering	Date Of Service:	16-05-2024
Type Of Inspection:	CAT III INSPECTION	Report No:	ATS-05-24-3200-SC-001
Rig & Rig Number:	RIG-99	Specification:	API RP 8C

Visual & Magnetic Particles Examination Report

Client Name:	Hilong Oil Services & Engineering	Location:	R149	Job Number:	ATS-05-24-3200
Date of Examination:	16-05-2024	Date of Report:	16-05-2024	Certificate No:	ATS-05-24-3200-SC-001

Serial Number	Description of the examined equipment	Result
80761	Safety Clamp	Pass
S/N:	80761	



NDT Equipment Details

Standard	API RP 8C & ASTM E 709	Viewing Condition:	Colored Media	Method	WET
Yoke	AC YOKE	Serial No:	201504044	Due Date	04-07-2024
White Contrast	FLUXO: WCP-4	Batch No:	L230523/1	Due Date	23-05-2028
Black Ink	FLUXO: Black magnetic ink-3	Batch No:	L230125/3	Due Date	25-1-2025


NDT procedure

Visual and MPI carried out for the above description and found free of surface defects at the time of inspection

Identification of any part found to have a defect and a description of the defect: **None**

Particulars of any repair, renewal or alteration required to remedy the defect identified above: **None**

ASNT Level II Inspector Name:	Signature & Stamp:	Date of Next Through Examination:
Aram Dlawar		15-05-2024

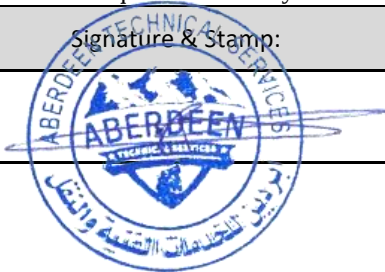

International
Well Control
Forum



Tel: +964 7833334444 +964 7822222633

Emails: akader@aberdeents.com
inspection@aberdeents-iq.com