



Certificate of Thorough Examination & NDT of Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

Client Name:	Hilong Oil Services & Engineering	Rig Number:	RIG-100	Job Number:	ATS-06-24-3466
Date of Examination:	23-06-2024	Date of Next Examination:	22-12-2024	Certificate No:	ATS-06-24-3466-016

Serial Number:	QTY	Description	SWL	Date of last Thorough examination
DZ039 DZ040	02	Fabricated Pad Eyes Pad Eye Dimension Thickness: 25 MM Pin Hole : 45 MM Length : 160 MM Height : 195 MM Location: V-door	1 T	Jan-2024
				

Reference Standard:	LEEA DOC 048:2015			
Is this the first examination after Installation or assembly at a new site or location?	YES	NO	✓	
If the answer to the above question is YES has the equipment been installed correctly?	YES	NO		
Was the examination carried out: Within an interval of 6 months? With an interval of 12 months? In accordance with an examination scheme? After the occurrence of exceptional circumstances?	YES	✓	NO	
	YES		NO	✓
	YES	✓	NO	
	YES		NO	✓

Identification of any part found to have a defect which is or could not become a danger to persons and a description of the defect: (If none Sate NONE) **NONE**

Is the above a defect which is of immediate danger to persons: YES NO

Is the above a defect which is not yet but could become a danger to persons (If YES state the date by when) N/A

Particulars of any repair, renewal or alteration required to remedy the defect identified above: **NONE**

IS THIS EQUIPMENT SAFE TO OPERATE? YES ✓ NO

NDT Equipment Details					
Standard	API RP 4G CAT IV & ASTM E709	Viewing Condition:	Colored Media	Method	WET
Yoke	AC yoke	Serial No:	201504044	Due Date	04-07-2024
Vernier Caliper	Digital	Serial No:	8914	Due Date	04-07-2024
White Contrast	FLUXO: WCP-4	Batch No:	L230523/1	Due Date	23-May-2028
Black Ink	FLUXO: Black magnetic ink-3	Batch No:	L230125/3	Due Date	25-Jan-2025


NDT Results

Visual and MPI carried out for the above description and found free of surface defects at the time of inspection

Identification of any part found to have a defect and a description of the defect: **NONE**

Particulars of any repair, renewal or alteration required to remedy the defect identified above: **NONE**

Name of Inspector:	Name of person authenticating this report:
Aram Dlawar 	Meysam Minaei

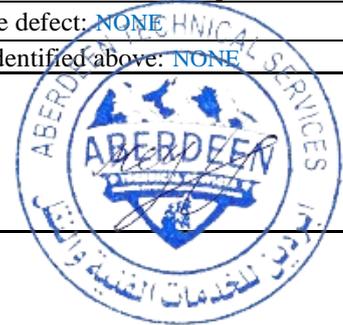



Certificate of Thorough Examination & NDT of Lifting Equipment

This Certificate complies with the requirements of the Lifting Equipment Operations and Lifting Equipment Regulations

Table with client details: Client Name (Hilong Oil Services & Engineering), Rig Number (RIG-100), Job Number (ATS-06-24-3466), Date of Examination (23-06-2024), Date of Next Examination (22-12-2024), Certificate No (ATS-06-24-3466-016)

Table with columns: Serial Number, QTY, Description, SWL, Date of last Thorough examination. Includes details for Fabricated Pad Eyes (DZ041, DZ042) with dimensions and photos.

Reference Standard: LEEA DOC 048:2015. Inspection questions regarding examination frequency and safety status.

NDT Equipment Details table listing Standard, API RP 4G CAT IV & ASTM E709, Viewing Condition, Colored Media, Method, and WET.

NDT Results section stating Visual and MPI carried out for the above description and found free of surface defects.

Inspector and authenticator information: Name of Inspector (Aram Dlawar), Name of person authenticating this report (Meysam Minaei).

