



ABERDEEN TECHNICAL SERVICES AND GENERAL TRANSPORTATION

SLIP TYPE ELEVATOR - CAT IV INSPECTION REPORT


Customer:	Hilong Oil Services & Engineering	Date Of Service:	07-08-2024
Type Of Inspection:	CAT IV INSPECTION	Report No:	ATS-08-24-4132-STE-020
Rig & Rig Number:	RIG-100	Specification:	API RP 8B



ABERDEEN Technical Services Would Like to Thank You for Giving Us the Opportunity to Work With Your Honorable Company

Inspection Date:	07-08-2024	Due Date:	06-08-2025
------------------	------------	-----------	------------

Inspector:	Aram Dlawar	Supervisor:	Hasan Omran
OEM:			

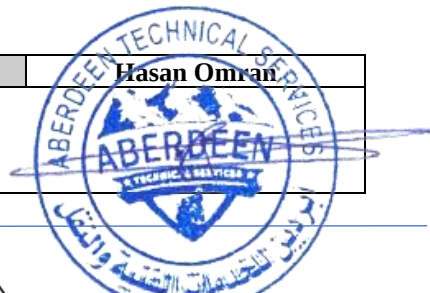

Tel: +964 7833334444 +964 7822222633
Emails: akader@aberdeents.com
inspection@aberdeents-iq.com



ABERDEEN TECHNICAL SERVICES AND GENERAL TRANSPORTATION

SLIP TYPE ELEVATOR - CAT IV INSPECTION REPORT

Customer:	Hilong Oil Services & Engineering	Date Of Service:	07-08-2024
Type Of Inspection:	CAT IV INSPECTION	Report No:	ATS-08-24-4132-STE-020
Rig & Rig Number:	RIG-100	Specification:	API RP 8B


The Rig Was Equipped with JIANGSU RUTONG PETRO-MACHINERY CO. Slip Type Elevator, with The Following Specification:

Equipment:	Slip Type Elevator, YT-75
SN:	90502
Date of Manufacture:	-
Manufacturer/ Model:	JIANGSU RUTONG PETRO-MACHINERY
Reference Standard:	API RP 8C
Next Examination Date:	After 6 Months

Remarks:

Detailed reports are attached detailing all readings and results in - 03 of 07 pages.

Inspector:	Aram Dlawar	Supervisor:	Hasan Omran
OEM:			

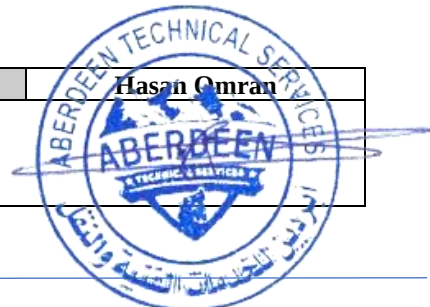

International
Well Control
Forum



Tel: +964 7833334444 +964 7822222633

Emails: akader@aberdeents.com
inspection@aberdeents-iq.com



ABERDEEN TECHNICAL SERVICES AND GENERAL TRANSPORTATION



SLIP TYPE ELEVATOR - CAT IV INSPECTION REPORT

Customer:	Hilong Oil Services & Engineering	Date Of Service:	07-08-2024
Type Of Inspection:	CAT IV INSPECTION	Report No:	ATS-08-24-4132-STE-020
Rig & Rig Number:	RIG-100	Specification:	API RP 8B

PROCEDURE

- The Slip Type Elevator Has Been Inspected and Found Conformable to the Relevant Standard(s)
- The Rig was equipped with **JIANGSU RUTONG PETRO-MACHINERY CO. LTD** Slip Type Elevator.
- Slip Type Elevator Found Stripped Down / Dismantled for CAT IV Inspection.

Action	Result
• Visually check for the serial number and Identification	Pass
• Dismantle the elevator as far as possible into single components	Pass
• Prepare and clean the elevator body and accessories to the extent necessary for inspection.	Pass
• Visually check for any damage, missing parts, or cracks	Pass
• Visually check & MPI as per manufacture's recommendations	Pass
• Measure the wear of center latch, and link ears (Lifting arms), Hinge Pins & Pinholes, etc. as per manufacture's recommendations.	Pass
• Visually check after Reassemble the Elevator with new spring and spare parts.	Pass
• Repaint the Elevator	Pass
• Prepare and submit the inspection report.	

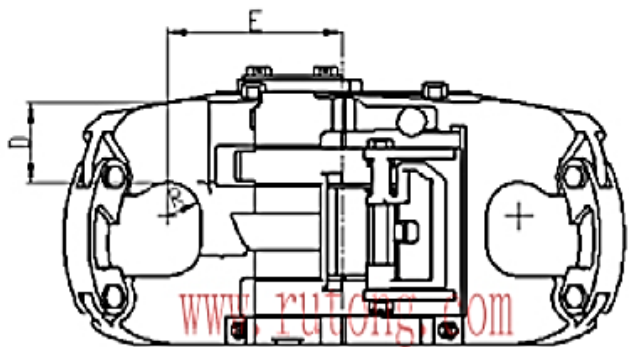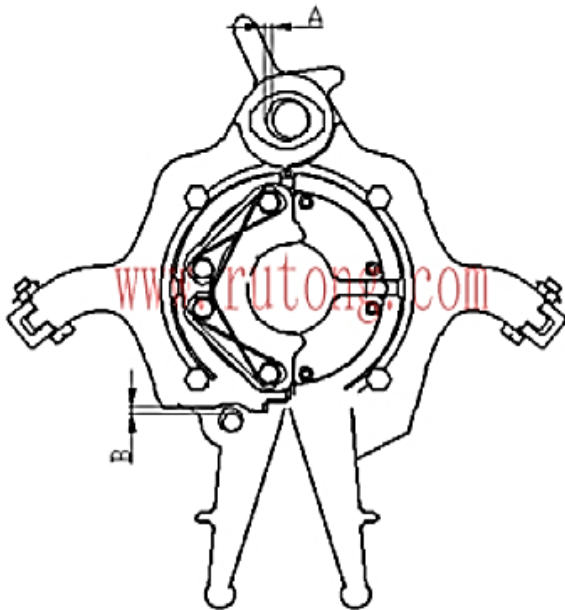

OREINTATION	DESCRIPTION	VALUES	OEM VALUES	RESULT
RIGHT	The maximum allowable wear tolerance of (D)	88 mm	84 mm	Accepted
	The distance "E" from the center line to the center of Arc	185 mm	185 mm	Accepted
	The designed value for radius "R" at the force point	40 mm	40 mm	Accepted
LEFT	The maximum allowable wear tolerance of (D)	88 mm	84 mm	Accepted
	The distance "E" from the center line to the center of Arc	185 mm	185 mm	Accepted
	The designed value for radius "R" at the force point	40 mm	40 mm	Accepted



Tel: +964 7833334444 +964 7822222633

Emails: akader@aberdeents.com



inspection@aberdeents-iq.com



ABERDEEN TECHNICAL SERVICES AND GENERAL TRANSPORTATION

SLIP TYPE ELEVATOR - CAT IV INSPECTION REPORT

Customer:	Hilong Oil Services & Engineering	Date Of Service:	07-08-2024
Type Of Inspection:	CAT IV INSPECTION	Report No:	ATS-08-24-4132-STE-020
Rig & Rig Number:	RIG-100	Specification:	API RP 8B

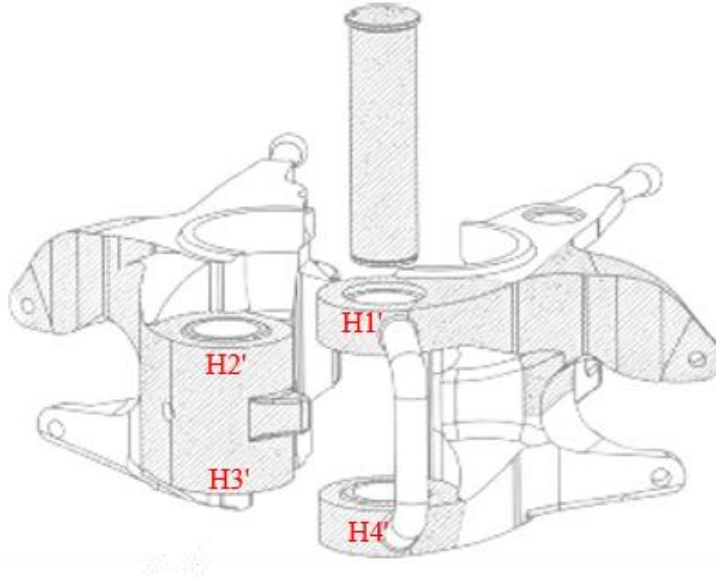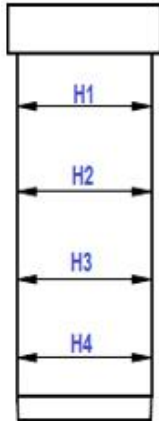

slip type elevator – CAT IV Dimensional Verification Checklist				
Measurement	Nominal	Tolerance (A)	Actual Reading	Result
Hinge Pin OD (H1)	41.25	0.76	41.13	Accepted
Hinge Pin OD (H2)	41.25		41.21	Accepted
Hinge Pin OD (H3)	41.25		41.19	Accepted
Hinge Pin OD (H4)	41.25		41.17	Accepted
Hinge Hole ID (H1')	41.28		41.53	Accepted
Hinge Hole ID (H2')	41.28		41.50	Accepted
Hinge Hole ID (H3')	41.28		41.54	Accepted
Hinge Hole ID (H4')	41.28		41.53	Accepted



Tel: +964 7833334444 +964 7822222633

Emails: akader@aberdeents.com


inspection@aberdeents-iq.com



ABERDEEN TECHNICAL SERVICES AND GENERAL TRANSPORTATION

SLIP TYPE ELEVATOR - CAT IV INSPECTION REPORT

Customer:	Hilong Oil Services & Engineering	Date Of Service:	07-08-2024
Type Of Inspection:	CAT IV INSPECTION	Report No:	ATS-08-24-4132-STE-020
Rig & Rig Number:	RIG-100	Specification:	API RP 8B

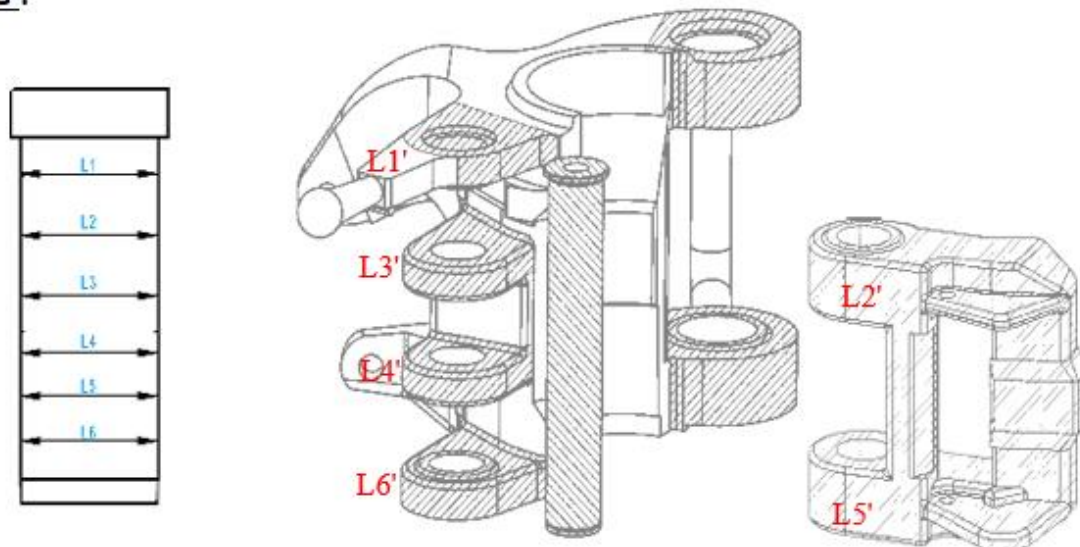


Slip type elevator – CAT IV Dimensional Verification Checklist				
Measurement	Nominal	Tolerance (B)	Actual Reading	Result
Latch Pin OD (L1)	34.87	0.76	34.72	Accepted
Latch Pin OD (L2)	34.87		34.70	Accepted
Latch Pin OD (L3)	34.87		34.71	Accepted
Latch Pin OD (L4)	34.87		34.72	Accepted
Latch Hole ID (L1')	34.93		34.93	Accepted
Latch Hole ID (L2')	34.93		34.94	Accepted
Latch Hole ID (L3')	34.93		34.94	Accepted
Latch Hole ID (L4')	34.93		34.95	Accepted

** Visual And MPI Was Carried out on the critical areas and load bearing components of the elevator and Found **Satisfactory for Further Use**.

** CAT IV Inspection Was Carried Out on the Elevator and Found **Accepted**
At The Time of Inspection

Inspector:	Aram Dlawar	Supervisor:	Hanan Omran
OEM:			

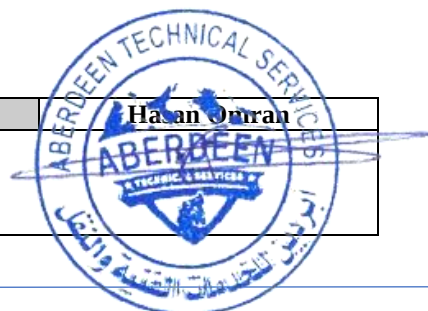

Tel: +964 7833334444 +964 7822222633
Emails: akader@aberdeents.com
inspection@aberdeents-iq.com



ABERDEEN TECHNICAL SERVICES AND GENERAL TRANSPORTATION

SLIP TYPE ELEVATOR - CAT IV INSPECTION REPORT

Customer:	Hilong Oil Services & Engineering	Date Of Service:	07-08-2024
Type Of Inspection:	CAT IV INSPECTION	Report No:	ATS-08-24-4132-STE-020
Rig & Rig Number:	RIG-100	Specification:	API RP 8B

Visual & Magnetic Particles Examination Report

Client Name:	Hilong Oil Services & Engineering	Location:	HL-100/ R026	Job Number:	ATS-08-24-4132
Date of Examination:	07-08-2024	Date of Report:	07-08-2024	Certificate No:	ATS-08-24-4132-STE-020

Serial Number	Description of the examined equipment	Result
90502	Slip Type Elevator, YT-75	Pass
S/N:	-	



NDT Equipment Details

Standard	API RP 8B – CAT IV & ASTM E 709	Viewing Condition:	Colored Media	Method	WET
Yoke	AC YOKE	Serial No:	201504044	Due Date	27-12-2024
White Contrast	FLUXO: WCP-4	Batch No:	L230523/1	Due Date	23-05-2028
Black Ink	FLUXO: Black magnetic ink-3	Batch No:	L230125/3	Due Date	25-1-2025

NDT procedure

Visual and MPI carried out for the above description and found free of surface defects at the time of inspection

Identification of any part found to have a defect and a description of the defect: **None**

Particulars of any repair, renewal or alteration required to remedy the defect identified above: **None**

ASNT Level II Inspector Name:	Signature & Stamp	Date of Next Through Examination:
Aram Dlawar		06-08-2025



Tel: +964 7833334444 +964 7822222633

Emails: akader@aberdeents.com
inspection@aberdeents-iq.com



ABERDEEN TECHNICAL SERVICES AND GENERAL TRANSPORTATION

SLIP TYPE ELEVATOR - CAT IV INSPECTION REPORT

Customer:	Hilong Oil Services & Engineering	Date Of Service:	07-08-2024
Type Of Inspection:	CAT IV INSPECTION	Report No:	ATS-08-24-4132-STE-020
Rig & Rig Number:	RIG-100	Specification:	API RP 8B

Visual & Magnetic Particles Examination Report

Client Name:	Hilong Oil Services & Engineering	Location:	HL-100/ R026	Job Number:	ATS-08-24-4132
Date of Examination:	07-08-2024	Date of Report:	07-08-2024	Certificate No:	ATS-08-24-4132-STE-020

Serial Number	Description of the examined equipment	Result
90502	Slip Type Elevator, YT-75	Pass
S/N:	-	



NDT Equipment Details

Standard	API RP 8B – CAT IV & ASTM E 709	Viewing Condition:	Colored Media	Method	WET
Yoke	AC YOKE	Serial No:	201504044	Due Date	27-12-2024
White Contrast	FLUXO: WCP-4	Batch No:	L230523/1	Due Date	23-05-2028
Black Ink	FLUXO: Black magnetic ink-3	Batch No:	L230125/3	Due Date	25-1-2025


NDT procedure

Visual and MPI carried out for the above description and found free of surface defects at the time of inspection

Identification of any part found to have a defect and a description of the defect: **None**

Particulars of any repair, renewal or alteration required to remedy the defect identified above: **None**

ASNT Level II Inspector Name:	Signature & Stamp	Date of Next Through Examination:
Aram Dlawar		06-08-2025

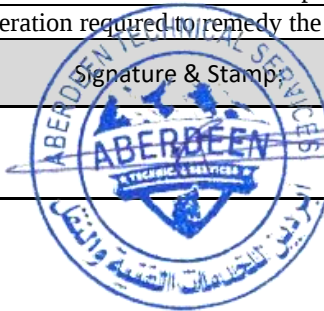

International Well Control Forum



Tel: +964 7833334444 +964 7822222633

Emails: akader@aberdeents.com
inspection@aberdeents-iq.com