



Inspection Service

This Service Presented To

HILONG

Inspection Service:	UT Wall Thickness Measurements (UTM)
Customer:	Hilong Oil Services & Engineering. Co.Ltd. Iraq Branch
Work Location:	HL – 22 / ZB-622
Inspection Date:	06 – December – 2024
Next Inspection Date:	05 – December – 2025
Inspector Name:	Aram Dlawar





Inspection Summary Report

Report No:	ATS-12-24-4628-UTM-015	Job No:	ATS-12-24-4628
Customer:	Hilong Oil Services & Engineering	Examination date:	06-December-2024
Location:	HL-22 / ZB-622	Next Due date:	05-December-2025



Equipment Details:		
Name of the Examined Equipment:	mud gate valve	
Summary of Procedures:		
Description of Step	Status	Remark
Visually Check For Any Damage Wear Distortionetc.	✓	Pass
Check Markings & Serial Number:	✓	Pass
Check The Ultrasonic Thickness Measuring Equipment before work:	✓	Pass
The Device Was Tested by The Test Block:	✓	Pass
Comparison Of Actual Reading with Minimum Thickness:	✓	Pass
UTM Interpretation against ASTM E797 Acceptance Criteria:	✓	Pass
ASNT Level II Inspector Name:	Signature & Stamp	
Aram Dlawar		





ABERDEEN TECHNICAL SERVICES AND GENERAL TRANSPORTATION

ULTRASONIC THICKNESS MEASUREMENT (UTM) CERTIFICATE



Client: Hilong Oil Services & Engineering	Location: Hilong - 22 / ZB - 622	Inspection Date: 06-Dec-2024
Certificate No: ATS-12-24-4628-UTM-015-1	Work order & Job No#: ATS-12-24-4628	Inspection Due Date: 05-Dec-2025
Item Description: 4" X 35 Mpa mud gate valve		
Serial No#: Y090320010006		
Relative Standards/Specifications: ASTM E 797 & Client Specifications		Material: Carbon Steel
Surface Condition: Brushed and Cleaned		Surface Temperature: 22 C°
Measuring Equipment		
UTM Instrument - Maker: Sona Test	Model: Sonagage IV	S. No.: 05058473
Pit Depth Gauge - Maker: New Tech	Model: NAA-4-M11118	S. No.: 97594
		Calibration Date: 28-June-2024
		Calibration Due Date: 27-Dec-2024

Sketch or picture (direct on this page or attached □)

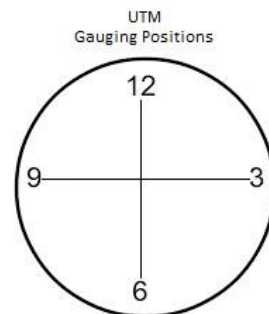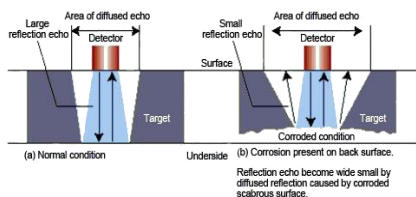

- 1: 12 O'clock position
- 2: 3 O'clock position
- 3: 6 O'clock position
- 4: 9 O'clock position

UTM Results							
Position	Nominal Wall Thickness	Minimum Thickness (mm)	Measured Wall Thickness (mm)				Remarks
A1	Nil	Need to be Provided from OEM by the client	34.46	34.40	34.50	34.55	Need Review
A2		Need to be Provided from OEM by the client	35.29	35.20	35.30	35.15	Need Review

Result:

- 1- UTM WAS CARRIED OUT ON THE ITEM AS MENTIONED EARLIER AND ALL ACTUAL WALL THICKNESS READINGS **SHOULD BE REVIEWED AGAINST THE OEM DOCUMENTS WHICH SHALL BE PROVIDED FROM THE OEM BY THE CLIENT**

Inspector Name:	Aram Dlawar	Reviewed by:	Hasan Omran	Signature & Stamp
Qualification:	ASNT Level II	Date:	07-Dec-2024	
Signature:		Signature:		



ATS-NDT-F-005 ISSUE 3 JUN 2023

Email: akader@aberdeents.com

inspection@aberdeents-iq.com

Tel: +964 7833334444 +964 782222633